

YOUR ONESURVEY

HOME REPORT

ADDRESS

1 Clarence Road
Dundee
DD4 7HP

PREPARED FOR

May Cumming

INSPECTION CARRIED OUT BY:

SELLING AGENT:

Rosie Fraser Real Estate



HOME REPORT GENERATED BY:



Document Index

Document	Status	Prepared By	Prepared On
Single Survey	Final	Dundee - Allied Surveyors Scotland Ltd	29/01/2026
Mortgage Certificate	Final	Dundee - Allied Surveyors Scotland Ltd	29/01/2026
Property Questionnaire	Final	Mrs. May Cumming	29/01/2026
EPC	FileUploaded	Dundee - Allied Surveyors Scotland Ltd	29/01/2026

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you log onto www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories
being rated from 1 to 3.



Single Survey

Survey report on:

Surveyor Reference	EA5116
Executive Of	Mrs. May Cumming
Selling address	1 Clarence Road Dundee DD4 7HP
Date of Inspection	28/01/2026
Prepared by	Graeme Millar, MRICS Dundee - Allied Surveyors Scotland Ltd

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

2 Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The subjects comprise a detached single storey bungalow.
Accommodation	GROUND FLOOR Entrance Vestibule, Hallway, Living Room, Kitchen, Two Shower Rooms, Two Bedrooms, Third Bedroom/Second Reception Room.
Gross internal floor area (m ²)	89
Neighbourhood and location	The subjects form part of an established residential area where surrounding properties are of varying age and character. An adequate range of facilities and amenities can be found within a reasonable distance.
Age	Approximately 90 years, extended around 2005.
Weather	Dry.
Chimney stacks	The chimney heads are of rendered brick construction with lead flashings and clay chimney pots. Visually inspected with the aid of binoculars where required.
Roofing including roof space	The roof is of pitched timber design, overlaid with slates, incorporating lead lined valleys. Sloping roofs were visually inspected with the aid of binoculars where required. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.

survey report

Rainwater fittings	Rainwater fittings are run in uPVC and cast iron. Visually inspected with the aid of binoculars where required.
Main walls	The main walls of the property are of traditional cavity construction, rendered externally. Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.
Windows, external doors and joinery	Windows are of uPVC double glazed type. Main entrance doors to the property are of uPVC double glazed type. Roof edge linings (fascia's and soffits) are formed in timber/uPVC. Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open.
External decorations	External cast iron components and masonry window sills are painted. Visually inspected.
Conservatories / porches	Not applicable.
Communal areas	Not applicable.
Garages and permanent outbuildings	To the rear of the property there is a substantial timber shed/workshop with a pitched asbestos cement sheet clad roof. Visually inspected.
Outside areas and boundaries	The property benefits from private garden grounds to the front, side and rear bounded by a combination of timber fencing and masonry walls. To the side of the property there is a monoblock surfaced off-street driveway. Visually inspected.
Ceilings	Ceilings within the property appear to be of plasterboard and lath & plaster. Visually inspected from floor level.

survey report

Internal walls	<p>Internal walls appear to be of plasterboard, lath & plaster and hard plaster.</p> <p>Walls within the shower room have been overclad in ceramic tiles.</p> <p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p>
Floors including sub floors	<p>The floor within the entrance vestibule is of solid concrete construction. Elsewhere, floors are of suspended timber construction.</p> <p>No sub-floor inspection was possible due to lack of suitable access.</p> <p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p>
Internal joinery and kitchen fittings	<p>Internal joinery comprises timber skirtings, facings, linings and internal doors.</p> <p>The kitchen comprises a range of base and wall mounted units.</p> <p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p>
Chimney breasts and fireplaces	<p>Within the living room there is a gas fire.</p> <p>Original fireplaces throughout the remainder of the property have been removed and the openings blocked up.</p> <p>Visually inspected. No testing of the flues or fittings was carried out.</p>
Internal decorations	<p>Internal surfaces are papered/painted.</p> <p>Visually inspected.</p>
Cellars	Not applicable.

survey report


Electricity	<p>A mains supply of electricity is connected with power points situated throughout the property. The main fuse board is located in the entrance vestibule whilst there is a consumer unit located in the rear hall, assumed to serve the rear extension.</p> <p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</p> <p>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p>
Gas	<p>A mains supply of gas is connected. The gas meter is located in an external meter box.</p> <p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</p> <p>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p>
Water, plumbing and bathroom fittings	<p>Water is supplied from the mains. Where viewed the plumbing system is of uPVC and copper pipework.</p> <p>The shower rooms both contain three piece suites consisting of shower enclosure, wash hand basin and w.c.</p> <p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p>
Heating and hot water	<p>Heating is provided by a gas fired combination boiler, located in the kitchen, which serves hot water radiators located throughout the property. Hot water is provided directly from the boiler on demand.</p> <p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p>
Drainage	<p>Drainage is assumed to be to the main Local Authority sewer.</p> <p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p>

survey report

Fire, smoke and burglar alarms	<p>Visually inspected.</p> <p>No test whatsoever were carried out to any systems or appliances.</p> <p>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</p> <p>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</p> <p>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.</p>
--------------------------------	---

Any additional limits to inspection	<p>Areas of the property that were covered, unexposed or inaccessible have not been inspected. It cannot be confirmed that such areas are free from infestation, decay or other defects.</p> <p>The property was fully furnished and floors were covered at the time of inspection. Our inspection was restricted due to stored items and personal belongings in built-in cupboards, which were not removed.</p> <p>An external inspection was carried out from ground level within the boundaries of the property and from adjoining highways.</p> <p>It was dry on the date of inspection. Leakage and water penetration within roof spaces, around chimney breasts, window openings, etc are sometimes only visible during or immediately after, adverse weather conditions.</p> <p>A limited inspection was possible of the roof void.</p> <p>No inspection of the sub floor area was possible.</p> <p>No close inspection was possible to enclosed areas beneath and around washing appliances and sanitary fittings.</p> <p>The report does not include an asbestos inspection. However, asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and should you have concerns you should engage a qualified asbestos surveyor.</p> <p>It should be appreciated that further defects can arise after the date of our inspection.</p> <p>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</p> <p>Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.</p>
-------------------------------------	--

Sectional Diagram showing elements of a typical house

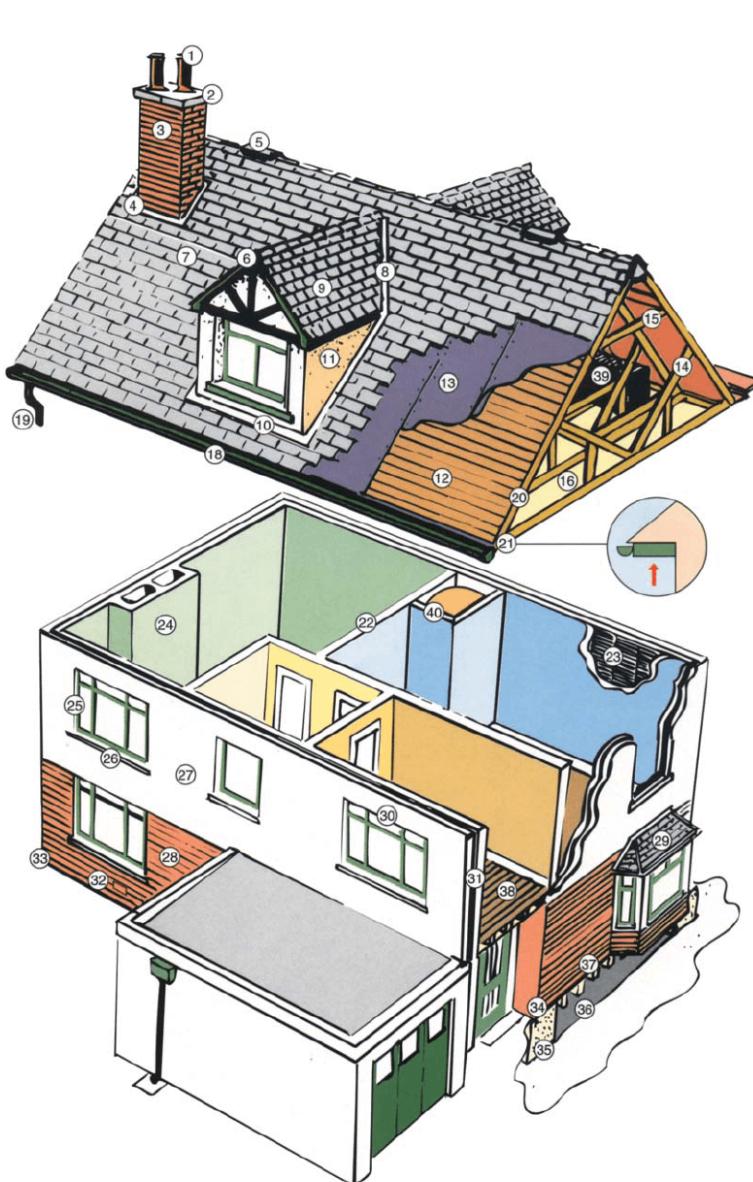

- 1 Chimney pots
- 2 Coping stone
- 3 Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6 Ridge board
- 7 Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10 Dormer flashing
- 11 Dormer cheeks
- 12 Sarking
- 13 Roof felt
- 14 Trusses
- 15 Collar
- 16 Insulation
- 17 Parapet gutter
- 18 Eaves guttering
- 19 Rainwater downpipe
- 20 Verge boards / skewers
- 21 Soffit boards
- 22 Partition wall
- 23 Lath / plaster
- 24 Chimney breast
- 25 Window pointing
- 26 Window sills
- 27 Rendering
- 28 Brickwork / pointing
- 29 Bay window projection
- 30 Lintels
- 31 Cavity walls / wall ties
- 32 Subfloor ventilator
- 33 Damp proof course
- 34 Base course
- 35 Foundations
- 36 Solum
- 37 Floor joists
- 38 Floorboards
- 39 Water tank
- 40 Hot water tank

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the above 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes:	On the basis of our single limited inspection there is no evidence of recent or ongoing movement affecting the subjects.

Dampness, rot and infestation	
Repair category:	1
Notes:	There is no evidence of dampness, rot or infestation affecting accessible areas.

Chimney stacks	
Repair category:	2
Notes:	<p>Chimney stacks are affected by weathering and erosion, typical of the age and type of construction. Ongoing maintenance should be anticipated.</p> <p>Defective render was noted to the northmost chimney stack.</p> <p>Disused chimneys can be a source of water ingress into the building fabric if not adequately maintained.</p>

survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including roof space		
Repair category:	2	
Notes:	<p>The roof covering appears to be the original and is affected by weathering, consistent with age.</p> <p>A number of slipped, damaged and missing slates were noted at the time of inspection.</p> <p>Given the age and type of the roof, it would be recommended that a reputable Roofing Contractor is instructed to inspect the roof and advise on any repairs required and anticipated remaining life span.</p>	

Rainwater fittings		
Repair category:	2	
Notes:	<p>Rainwater goods appear to be slightly off-level in places with some gutter joints showing signs of leakage. In addition, a section of gutter to the rear elevation was noted to be damaged.</p> <p>Defective rainwater goods can lead to water penetration into the building fabric.</p> <p>It should be noted that it was not raining heavily at the time of inspection. We are therefore unable to confirm that all gutter joints, downpipes etc are free from leaks or other defects.</p>	

Main walls		
Repair category:	2	
Notes:	<p>External render finishes are cracked/boss in places. This is likely to be a progressive defect if not attended to.</p>	

survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Windows, external doors and joinery	
Repair category:	2
Notes:	<p>The windows are of dated type and are affected by general age related wear and tear, including loose ironmongery and slightly stiff opening mechanisms.</p> <p>Windows generally require careful ongoing maintenance and with the passage of time can be prone to the failure of mechanisms and seals.</p> <p>One of the double glazed units to the front bedroom has failed, resulting in misting between the panes.</p> <p>Repairs/upgrades should be budgeted for.</p> <p>External doors are also affected by general age related wear and tear. Ongoing maintenance and repairs should be anticipated.</p>

External decorations	
Repair category:	1
Notes:	External decorations, whilst in generally reasonable order, are beginning to weather in places. Renewal will be required in due course.

Conservatories / porches	
Repair category:	
Notes:	Not applicable.

Communal areas	
Repair category:	
Notes:	Not applicable.

survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Garages and permanent outbuildings		
Repair category:	2	
Notes:	<p>The timber shed/workshop appears to be leaning. In addition, the asbestos cement sheet roof must be considered to be reaching the end of its performance life with some damaged sections. Replacement costs can be high. Removal should only be carried out by a licensed asbestos removal contractor.</p>	

Outside areas and boundaries		
Repair category:	2	
Notes:	<p>Sections of timber boundary fencing were noted to be rotten and leaning. Repairs/replacement will be required.</p> <p>Damaged/displaced tiling was noted to the front entrance step. Repairs will be required.</p>	

Ceilings		
Repair category:	1	
Notes:	<p>Unevenness and hairline cracking was noted to some ceiling surfaces. Localised plaster repairs may be required upon redecoration.</p> <p>In older lath & plaster ceilings it is not uncommon for the plaster to lose its bond with the underlying timber lath over time. Plaster repairs may be required, particularly where redecoration is undertaken.</p>	

Internal walls		
Repair category:	1	
Notes:	No significant reportable defects noted.	

survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Floors including sub-floors		
Repair category:	1	
Notes:	No significant reportable defects noted.	

Internal joinery and kitchen fittings		
Repair category:	1	
Notes:	Internal joinery is of mixed vintage and, whilst affected by wear and tear, appears in generally serviceable condition.	

Chimney breasts and fireplaces		
Repair category:	2	
Notes:	<p>The gas fire is of dated type. We would recommend that the gas fire is tested/serviced by a qualified gas engineer prior to use.</p> <p>Where original fireplaces are removed, it is important that chimneys are vented to prevent the build-up of condensation within the flue.</p>	

Internal decorations		
Repair category:	1	
Notes:	Internal decorations are affected by a degree of wear and tear but otherwise present in reasonable order.	

Cellars		
Repair category:		
Notes:	Not applicable.	

survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Electricity		
Repair category:	2	
Notes:	<p>The electrical installation is of mixed vintage, including some elements which would likely not comply with current regulations.</p> <p>It is recommended that electrical installations are checked by a qualified electrician every five years, or upon a change of ownership, at which point further repairs/upgrades may be identified.</p>	

Gas		
Repair category:	1	
Notes:	<p>Gas fittings have not been tested. We would recommend that all gas fittings/appliances are tested by a suitably qualified gas engineer prior to first use and annually thereafter.</p>	

Water, plumbing and bathroom fittings		
Repair category:	1	
Notes:	<p>The visible plumbing system generally appears in reasonable order with no evidence of leaks or other defects at the time of inspection.</p> <p>Sealant around the shower tray is beginning to deteriorate. It is important to maintain sealant/tile grout around baths and shower trays in order to prevent water ingress to concealed areas.</p>	

Heating and hot water		
Repair category:	2	
Notes:	<p>The boiler is slightly dated and may not be as efficient as a modern equivalent.</p> <p>It is recommended that gas boilers are serviced on an annual basis by a qualified gas engineer. This should be regarded as a routine safety and maintenance check. Purchasers are advised to obtain any previous service documentation.</p> <p>Radiator units are of mixed vintage with some affected by surface corrosion. Repairs/upgrades should be budgeted for.</p>	

survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Drainage	
Repair category:	1
Notes:	Visible, above ground drainage pipes appear in reasonable order. There was no evidence at the time of inspection to suggest that the system was choked or leaking.

survey report

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	1
Conservatories / porches	
Communal areas	
Garages and permanent outbuildings	2
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	2
Internal decorations	1
Cellars	
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	2
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground.
2. Are there three steps or fewer to a main entrance door of the property?	[x]YES []NO
3. Is there a lift to the main entrance door of the property?	[]YES [x]NO
4. Are all door openings greater than 750mm?	[]YES [x]NO
5. Is there a toilet on the same level as the living room and kitchen?	[x]YES []NO
6. Is there a toilet on the same level as a bedroom?	[x]YES []NO
7. Are all rooms on the same level with no internal steps or stairs?	[x]YES []NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	[x]YES []NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchases contracts, further specialist advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

The valuation is made on the basis that any alterations that may have been carried out to the property satisfy all relevant legislation and have full certification where appropriate. While not necessarily an exhaustive list alterations noted at the time of our inspection include the addition of a single storey extension to the rear.

Estimated re-instatement cost (£) for insurance purposes

The subjects should be insured for a sum of not less than £300,000.

Three hundred thousand pounds

Valuation (£) and market comments

Market value assuming vacant possession is £270,000

Two hundred and seventy thousand pounds

Our valuation reflects current market conditions relating to this area. We would assume that current trends will prevail at the ultimate date of disposal with no adverse or onerous matters being introduced into the market during the intervening period which would have a detrimental effect on price.

Report author:	Graeme Millar, MRICS
Company name:	Dundee - Allied Surveyors Scotland Ltd
Address:	8 Whitehall Crescent Dundee DD1 4AU
Signed:	Electronically Signed: 305439-5dde6a7e-cfb3
Date of report:	29/01/2026

P A R T 2 .

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.





Mortgage Valuation Report

Property:	1 Clarence Road Dundee DD4 7HP	Executor of Mrs. May Cumming Tenure: Absolute Ownership
Date of Inspection:	28/01/2026	Reference: GM/GS/EA5116

This report has been prepared as part of the seller's instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising a potential lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.

1.0	LOCATION													
The subjects form part of an established residential area where surrounding properties are of varying age and character. An adequate range of facilities and amenities can be found within a reasonable distance.														
2.0	DESCRIPTION			2.1 Age:	Approximately 90 years, extended around 2005.									
The subjects comprise a detached single storey bungalow.														
3.0	CONSTRUCTION													
WALLS: cavity, rendered.														
ROOF: pitched, slated.														
4.0	ACCOMMODATION													
GROUND FLOOR Entrance Vestibule, Hallway, Living Room, Kitchen, Two Shower Rooms, Two Bedrooms, Third Bedroom/Second Reception Room.														
5.0	SERVICES (No tests have been applied to any of the services)													
Water:	Mains	Electricity:	Mains	Gas:	Mains	Drainage:								
Central Heating:	Full, gas.													
6.0	OUTBUILDINGS													
Garage:	None.													
Others:	Timber shed/workshop													

7.0	GENERAL CONDITION - A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.
-----	---

At the time of inspection the subjects were found to be in a condition of repair generally consistent with age and type and form suitable security for mortgage purposes subject to individual lender criteria.

8.0	ESSENTIAL REPAIR WORK (as a condition of any mortgage or, to preserve the condition of the property)
-----	---

None.

8.1 Retention recommended:	N/A
----------------------------	-----

9.0	ROADS & FOOTPATHS
-----	------------------------------

Made up.

10.0	BUILDINGS INSURANCE (£):	300,000	GROSS EXTERNAL FLOOR AREA	102	Square metres
	<p><i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i></p>				

11.0	GENERAL REMARKS
------	------------------------

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchases contracts, further specialist advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

The valuation is made on the basis that any alterations that may have been carried out to the property satisfy all relevant legislation and have full certification where appropriate. While not necessarily an exhaustive list alterations noted at the time of our inspection include the addition of a single storey extension to the rear.

12.0	VALUATION On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.
------	---

12.1	Market Value in present condition (£):	270,000	Two Hundred and Seventy Thousand Pounds.
------	---	---------	--

12.2	Market Value on completion of essential works (£):		
------	---	--	--

12.3	Suitable security for normal mortgage purposes?	Yes
------	--	-----

12.4	Date of Valuation:	28/01/2026
------	---------------------------	------------

Signature:	Electronically Signed: 305439-5dde6a7e-cfb3
-------------------	---

Surveyor:	Graeme Millar	MRICS	Date:	29/01/2026
Dundee - Allied Surveyors Scotland Ltd				
Office:	8 Whitehall Crescent Dundee DD1 4AU	Tel: 01382 349 930 Fax: email: dundee@alliedsurveyorsscotland.com		

P A R T 3 .

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	1 Clarence Road Dundee DD4 7HP
Customer	Mrs. May Cumming
Customer address	1 Clarence Road Dundee DD4 7HP
Prepared by	Graeme Millar, MRICS Dundee - Allied Surveyors Scotland Ltd

Energy Performance Certificate (EPC)

Scotland

Dwellings

1 CLARENCE ROAD, DUNDEE, DD4 7HP

Dwelling type: Detached bungalow
Date of assessment: 28 January 2026
Date of certificate: 29 January 2026
Total floor area: 89 m²
Primary Energy Indicator: 264 kWh/m²/year


Reference number: 2883-1047-1239-2806-2220
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£4,608	See your recommendations report for more information
Over 3 years you could save*	£948	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

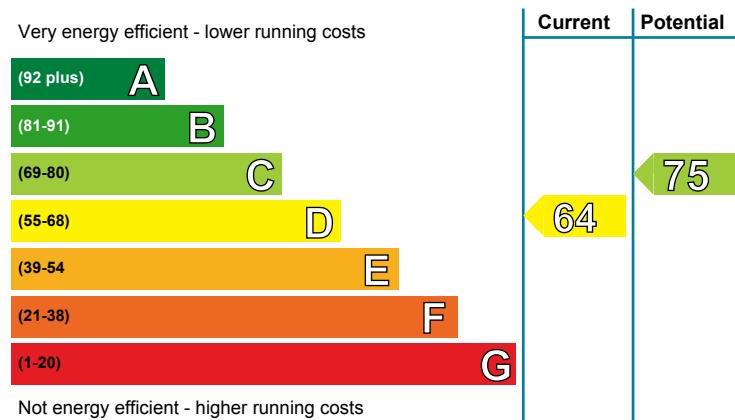


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (64)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

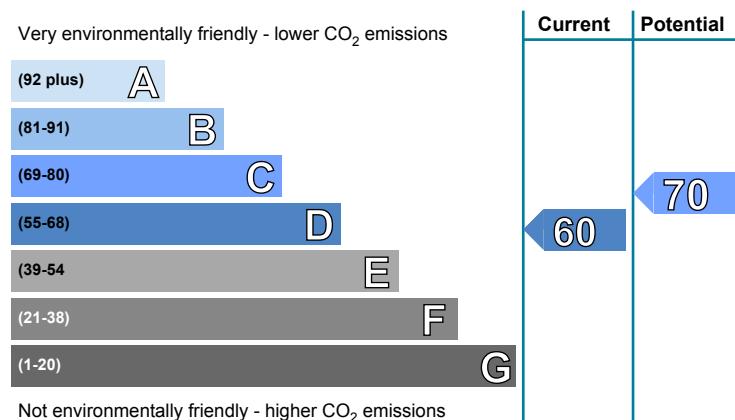

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (60)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Cavity wall insulation	£900 - £1,500	£357.00
2 Floor insulation (suspended floor)	£5,000 - £10,000	£405.00
3 Heating controls (room thermostat)	£220 - £250	£183.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Cavity wall, as built, insulated (assumed)	★★★★☆	★★★★☆
Roof	Pitched, 150 mm loft insulation	★★★★☆	★★★★☆
	Pitched, 200 mm loft insulation	★★★★☆	★★★★☆
Floor	Suspended, no insulation (assumed)	—	—
	Suspended, insulated (assumed)	—	—
Windows	Fully double glazed	★★☆☆☆	★★☆☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, TRVs and bypass	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Good lighting efficiency	★★★★☆	★★★★☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 48 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 4.3 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.1 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£3,843 over 3 years	£2,895 over 3 years	
Hot water	£594 over 3 years	£594 over 3 years	
Lighting	£171 over 3 years	£171 over 3 years	
Totals	£4,608	£3,660	 You could save £948 over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Cavity wall insulation	£900 - £1,500	£119	D 67	D 64
2 Floor insulation (suspended floor)	£5,000 - £10,000	£135	C 69	D 68
3 Upgrade heating controls	£220 - £250	£61	C 71	C 69
4 Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£210	C 75	C 70

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	13,524.62	N/A	N/A	N/A
Water heating (kWh per year)	2,425.65			

Addendum

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Graeme Millar
Assessor membership number:	EES/022017
Company name/trading name:	Allied Surveyors Scotland Ltd
Address:	8 Whitehall Crescent Dundee DD1 4AU
Phone number:	01382 349930
Email address:	gary.black@alliedsurveyorsscotland.com
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.


HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.

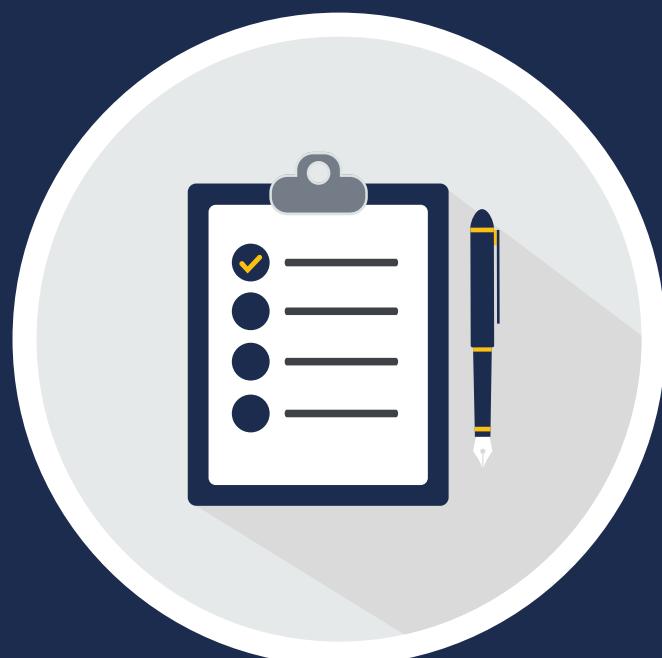

Property Questionnaire

Property Address

1 Clarence Road

Dundee

DD4 7HP

Seller(s)

May Cumming

Completion date of property questionnaire

29/01/2026

Note for sellers

1.	Length of ownership
	How long have you owned the property? 21 years
2.	Council tax
	Which Council Tax band is your property in? (Please circle) []A []B []C []D [x]E []F []G []H
3.	Parking
	What are the arrangements for parking at your property? (Please tick all that apply) Garage [] Allocated parking space [] Driveway [x] Shared parking [] On street [] Resident permit [] Metered parking [] Other (please specify):

property questionnaire

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
6.	Alterations/additions/extensions	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, please describe below the changes which you have made: <i>Extension to rear of property</i>	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them: <i>I am applying for the completion certificate</i>	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	(ii) Did this work involve any changes to the window or door openings?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Please give any guarantees which you received for this work to your solicitor or estate agent.	
7.	Central heating	

property questionnaire

a	<p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).</p>	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Partial
	<p>If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p><i>Gas</i></p>	
	<p>If you have answered yes, please answer the three questions below:</p>	
	<p>(i) When was your central heating system or partial central heating system installed?</p> <p><i>20 years ago but boiler replaced 7 years ago</i></p>	
	<p>(ii) Do you have a maintenance contract for the central heating system?</p>	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
	<p>If you have answered yes, please give details of the company with which you have a maintenance contract</p> <p><i>British gas</i></p>	
	<p>(iii) When was your maintenance agreement last renewed? (Please provide the month and year).</p> <p><i>Last year</i></p>	
8.	Energy Performance Certificate	
	<p>Does your property have an Energy Performance Certificate which is less than 10 years old?</p>	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
9.	Issues that may have affected your property	
a	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p>	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	<p>If you have answered yes, is the damage the subject of any outstanding insurance claim?</p>	<input type="checkbox"/> YES <input type="checkbox"/> NO
b	<p>Are you aware of the existence of asbestos in your property?</p>	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know
	<p>If you have answered yes, please give details:</p> <p><i>Garage roof is cement sheets</i></p>	
10.	Services	

property questionnaire

a	Please tick which services are connected to your property and give details of the supplier:																										
	<table border="1"> <thead> <tr> <th>Services</th> <th>Connected</th> <th>Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas or liquid petroleum gas</td> <td>Y</td> <td>EDF</td> </tr> <tr> <td>Water mains or private water supply</td> <td>Y</td> <td>Scottish Water</td> </tr> <tr> <td>Electricity</td> <td>Y</td> <td>EDF</td> </tr> <tr> <td>Mains drainage</td> <td>Y</td> <td>Scottish Water</td> </tr> <tr> <td>Telephone</td> <td>Y</td> <td>BT</td> </tr> <tr> <td>Cable TV or satellite</td> <td>Y</td> <td>Virgin media</td> </tr> <tr> <td>Broadband</td> <td>Y</td> <td>Sky</td> </tr> </tbody> </table>			Services	Connected	Supplier	Gas or liquid petroleum gas	Y	EDF	Water mains or private water supply	Y	Scottish Water	Electricity	Y	EDF	Mains drainage	Y	Scottish Water	Telephone	Y	BT	Cable TV or satellite	Y	Virgin media	Broadband	Y	Sky
Services	Connected	Supplier																									
Gas or liquid petroleum gas	Y	EDF																									
Water mains or private water supply	Y	Scottish Water																									
Electricity	Y	EDF																									
Mains drainage	Y	Scottish Water																									
Telephone	Y	BT																									
Cable TV or satellite	Y	Virgin media																									
Broadband	Y	Sky																									
b	Is there a septic tank system at your property?		[]YES [x]NO																								
	If you have answered yes, please answer the two questions below:																										
	(i) Do you have appropriate consents for the discharge from your septic tank?		[]YES []NO []Don't know																								
	(ii) Do you have a maintenance contract for your septic tank?		[]YES []NO																								
	If you have answered yes, please give details of the company with which you have a maintenance contract:																										
11.	Responsibilities for shared or common areas																										
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details: <i>Boundary fencing</i>		[x]YES []NO []Don't know																								
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:		[]YES [x]NO []N/A																								
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?		[]YES [x]NO																								
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:		[]YES [x]NO																								
<p>1 Clarence Road, Dundee, DD4 7HP</p>																											

property questionnaire

e	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p>If you have answered yes, please give details:</p>	[]YES [x]NO
f	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.)</p> <p>If you have answered yes, please give details:</p>	[]YES [x]NO
12. Charges associated with your property		
a	<p>Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</p>	[]YES [x]NO
b	<p>Is there a common buildings insurance policy?</p>	[]YES [x]NO []Don't know
	<p>If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?</p>	
c	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>	
13. Specialist works		
a	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p>	[]YES [x]NO
	<p>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.</p>	
b	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p>	[]YES [x]NO
	<p>If you have answered yes, please give details:</p>	
c	<p>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</p>	[]YES []NO
	<p>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	

property questionnaire

14. Guarantees		
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	[]NO []YES [x]Don't know []With title deeds []Lost
(ii)	Roofing	[x]NO []YES []Don't know []With title deeds []Lost
(iii)	Central heating	[]NO []YES [x]Don't know []With title deeds []Lost
(iv)	National House Building Council(NHBC)	[x]NO []YES []Don't know []With title deeds []Lost
(v)	Damp course	[x]NO []YES []Don't know []With title deeds []Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	[x]NO []YES []Don't know []With title deeds []Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	[]YES [x]NO
	If you have answered yes, please give details:	

15. Boundaries		
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	[]YES [x]NO []Don't know
	If you have answered yes, please give details:	
16. Notices that affect your property		
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	[]YES [x]NO
b	that affects your property in some other way?	[]YES [x]NO
c	that requires you to do any maintenance, repairs or improvements to your property?	[]YES [x]NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

property questionnaire

Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):	Paul Cumming
Capacity:	<input checked="" type="checkbox"/> Owner <input type="checkbox"/> Legally Appointed Agent for Owner
Date:	29/01/2026